

S/No. TR-2007-227-006

## 【Vehicle Details】

Chassis No: URJ202-4139064 Model: CBA-URJ202W Engine Model: 1UR  
 Maker: TOYOTA 1st Registration Year: 2016/11 Engine No: 0646132  
 Model Name: \_\_\_\_\_ Manufacture Year: 2016 Weight: 2530 Kg  
 Engine Capacity: 4600 cc Type of Vehicle: Station Wagon FF Axis Weight: 1350 Kg  
 Body Color: White Mileage (Paper): 0 Km FR Axis Weight: \_\_\_\_\_ Kg  
 Fuel Type: GASOLINE Odometer: 28,895 km RF Axis Weight: \_\_\_\_\_ Kg  
 RR Axis Weight: 1180 Kg

## 【Inspection Details】

Location: Nagoya Inspector: Rie Higuchi

## 【Test Drive】

Abnormal at Acceleration ☒ Pass/Fail  
 Abnormal at Brake Test ☒ Pass/Fail

## 【Exhaust】

CO 0.20 % ☒ Pass/Fail  
 HC 80 ppm ☒ Pass/Fail  
 DS \_\_\_\_\_ %/m-1 ☒ Pass/Fail

## 【Headlights】

Luminance R 360 x100cd ☒ Pass/Fail  
 L 380 x100cd ☒ Pass/Fail

## 【Side Slip】

IN / OUT 1.0 mm ☒ Pass/Fail

## 【Exhaust proximity noise】

Average \_\_\_\_\_ dB(A) ☒ Pass/FailAttachment R \_\_\_\_\_ cm ☒ Pass/Fail(Height) L \_\_\_\_\_ cm ☒ Pass/FailOptical Axis R \_\_\_\_\_ cm ☒ Pass/Fail(Under) L \_\_\_\_\_ cm ☒ Pass/FailOptical Axis R \_\_\_\_\_ cm ☒ Pass/Fail(RL) L \_\_\_\_\_ cm ☒ Pass/Fail

## 【Speedometer】

Difference 0.0 km/h ☒ Pass/FailRun-out 0 km/h ☒ Pass/Fail

## 【Radiation Dose】

☒ Pass/Fail

## 【Brake System】

FL	400	kg	FR	410	kg	Sum main brake(Weight+55kg)	2585	x0.5=	1293	<	Sum Main brake=	1350	Pass/Fail
ML		kg	MR		kg	Sum parking brake(Weight+55kg)	2585	x0.2=	517	<	Sum parking brake=	520	✓
RL	270	kg	RR	270	kg	Sum R wheel brake(axis weight)	1180	x0.1=	118	<	Sum R wheel bake=	540	✓
PL	260	kg	PR	260	kg	Pull:Front(axis Weight+55kg)	1405	x0.08=	113	>	Diff b/w R&L axis=	10	✓
						Pull:Rear(axis Weight)	1180	x0.08=	95	>	Diff b/w R&L axis=	0	✓

## 【Engine】

Engine ☒ Result  
 Fan belt ☒  
 Battery ☒  
 Master Cylinder ☒  
 Caburetor ☒  
 Fuel Pipes ☒  
 Injection Pump ☒  
 Wiring Haeness ☒  
 Generator ☒  
 Cooling Syatem ☒  
 Manifolds ☒  
 Lubrication System ☒  
 CFC ☒ R-134a

## 【Equipment】

Tool ☒ Result  
 Jack ☒


## 【Accessory】

A/C ☒  
 Audio ☒  
 Navigation ☒  
 Alloy Wheel ☒

AT/MT: AT

## 【Underbody】

Wheel Bearing ☒ Result  
 Springs ☒  
 Shock Absorbers ☒  
 Suspension Fixing ☒  
 Torque Rod ☒  
 Gear Box ☒  
 Steering Rod/Arm ☒  
 Wheel Cylinder ☒  
 Brake Rod/Cable ☒  
 Breake Hose/Pipe ☒  
 Front axle ☒  
 Drive Shaft ☒  
 Propeller Shaft ☒  
 Axle Housing ☒  
 Differential ☒  
 Tyre Size ☒  
 Tyre Condition ☒  
 Tyre ETC ☒

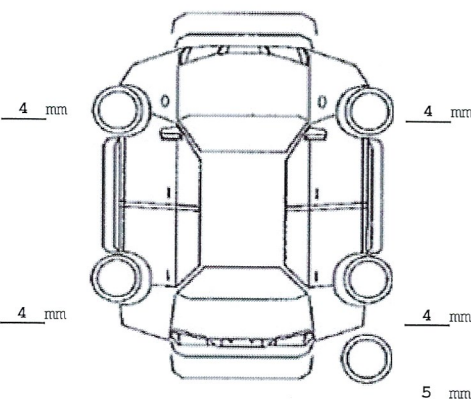

## 【Interior】

Steering Wheel ☒ Result  
 Power Steering ☒  
 Horn ☒  
 Gauges ☒  
 Climate Control ☒  
 Door ☒  
 Windows ☒  
 Wipers ☒  
 Mirrors(Back & Sides) ☒  
 Shift Lever ☒  
 Safety Belts ☒  
 Brake Pedal ☒  
 Brake Booster ☒  
 Clutch Pedal ☒  
 Clutch Function ☒

## 【Lights】

Head lamp ☒ Result  
 Indicator ☒  
 Rear ☒  
 Brake ☒  
 ETC ☒

## 【ETC】

Exhaust System ☒ Result  
 Air Suspension ☒  
 Air Brake ☒  
 Fuel Tank ☒

## 【Damage】

Exterior ☒ Result  
 Interior ☒  
 Underbody ☒

F=Repair A=Scratch U=Dent R=Rust CR=Crack D=Damage

## 【Result】

Pass ☒  
 Fail ☐

Inspector Signature Rie Higuchi  
 Inspection Date 2020-07-21

## 【Reinspection】

Pass ☐  
 Fail ☐

Inspector Signature \_\_\_\_\_  
 Inspection Date2 \_\_\_\_\_

## 【Fail Parts】

\_\_\_\_\_